
Date:	03/21/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft)		Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Selasie Honu	I	PSR:	P-902-057-056
Customer:		Clean Date:	01/01/1900		Shape:	С
Street:	RUSH PL		Flow Control:		Not Controlled	
City:	Hobart, IN		Year Renewed	:		
Location:	Other		Tape/Media #	:		
Purpose:	Not Known		Dia/Height:		10"	
Use:	Sanitary		Material:		VCP	
Drain Area:	NA		Lining:		Cured in Place	
Category:	NA					
Comment:	Pipe is surcharged					
Location Detail	s:		Direction of Su	irvey:	Upstream	
US MH:	M-902-056	DS MH:	M-902-057	Tot	al Length Surveyed (ft):	60.7
D&M Index:	0.00	O&M Quick:	0	000	O&M Rating:	0.00
Structural Index:	0.00	 Structural Qu	uick: 0	000	Structural Rating:	0.00
Overall Index:	0.00	Overall Quick		000	Overall Rating:	0.00





Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-902-057

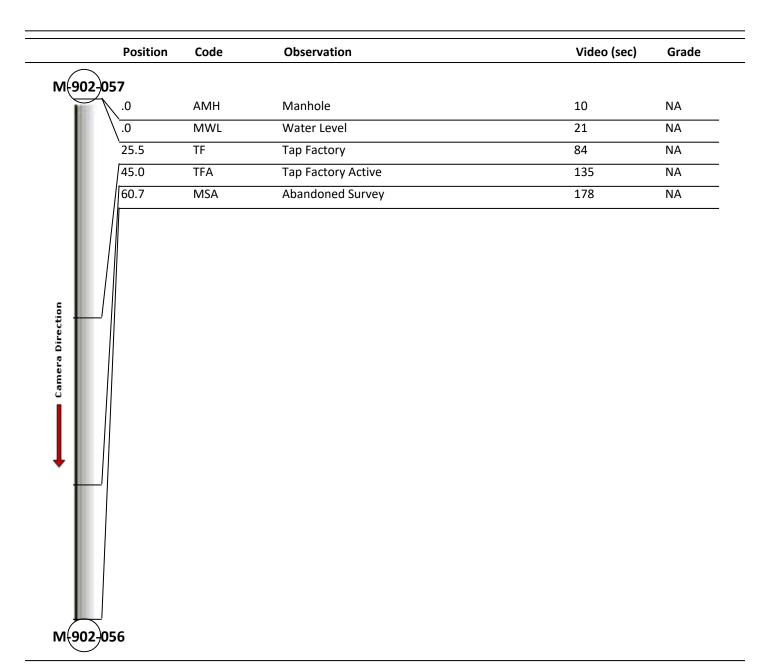

Code: MWL Description: Water Level

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0 Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: 5.000 Continuous Index: Within 8" of Joint: NO Remarks:



Code: Description:	TF Tap Factory
Distance (ft):	25.5
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	11
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	
Remarks:	

Thursday, November 16, 2023



Code:TFADescription:Tap Factory Active

Distance (ft): 45.0 Structural Grade: 0 O&M Grade: 0 Clock Start/From: 9 Clock To: 1st Value: 4.000 2nd Value: Value Percent: Continuous Index: Within 8" of Joint: Remarks:

Code: Description: MSA Abandoned Survey



Distance (ft):	60.7
Structural Grade:	
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	debris