Profile/Photo Observation Report



Date: 04/15/2018 Weather: **PACP 6.0** Coding: Pipe Length (ft): 253.2 Owner: NA Pre Clean: **Not Known** P.O.#: PSR: P-904-015-014 Surveyor: Selasie Honu

Customer: Clean Date: 01/01/1900 Shape: C

Street: Fraser Ln. Flow Control: Not Controlled
City: Hobart, IN Year Renewed:

Location: Other Tape/Media #:

Purpose: Not Known Dia/Height: 10"
Use: Sanitary Material: VCP

Drain Area: NA Lining:

Category: NA

Comment:

Location Details: Direction of Survey:

US MH: M-904-015 DS MH: M-904-014 Total Length Surveyed (ft): 36.5

 O&M Index:
 1.00
 O&M Quick:
 1100
 O&M Rating:
 1.00

 Structural Index:
 0.00
 Structural Quick:
 0000
 Structural Rating:
 0.00

 Overall Index:
 1.00
 Overall Quick:
 1100
 Overall Rating:
 1.00

Downstream

Overall Index: 1.00 Overall Quick: 1100 Overall Rating: 1.00

04-015 .0 .0 2.7 36.5	RI TF	MH IWL FJ F ISA	Manhole Water Level Roots Fine Joint Tap Factory Abandoned Survey	10 21 38 117 128	NA NA NA NA
.0 .0 2.7 36.5	RI TF	/IWL FJ F	Water Level Roots Fine Joint Tap Factory	21 38 117	NA M 1 NA
2.7 36.5	RI 5 TF	FJ F	Roots Fine Joint Tap Factory	38 117	M 1 NA
36.5	5 TF	F	Tap Factory	117	NA
36.5	i M	1SA	Abandoned Survey	128	NA

Code:



Description:	Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-904-015

 AMH



Code: MWL Description: **Water Level**

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0 Clock Start/From:

Clock To: 1st Value: 2nd Value:

Value Percent:

Continuous Index: Within 8" of Joint:


Remarks:

5.000

NO

Code: RFJ

Description: **Roots Fine Joint**

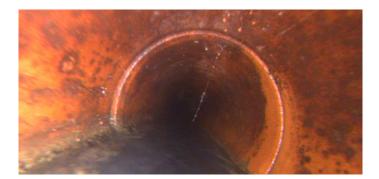

Distance (ft): 2.7 Structural Grade: 0 O&M Grade: 1 Clock Start/From: 1

Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index:

Within 8" of Joint:

Remarks:

YES



Code: **TF**

Description: Tap Factory

Distance (ft): 36.5
Structural Grade: 0
O&M Grade: 0
Clock Start/From: 3

Clock To:

1st Value: **4.000**

2nd Value: Value Percent: Continuous Index: Within 8" of Joint:

Remarks:



Code: MSA

Description: Abandoned Survey

Distance (ft): 36.5
Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:

Within 8" of Joint: NO

Remarks: camera stopped