Profile/Photo Observation Report

Date:	**03/22/2018**	Weather:		Coding:	**PACP 6.0**
Pipe Length (ft):	**149.5**	Owner:	**NA**	Pre Clean:	**No Pre-Cleaning**
P.O.#:		Surveyor:	**Selasie Honu**	PSR:	**P-208-026-025**
Customer:		Clean Date:	**01/01/1900**	Shape:	**C**

Street:	**FOXCROFT STREET**	Flow Control:	**Not Controlled**
City:	**Hobart, IN**	Year Renewed:	
Location:	**Light Highway**	Tape/Media #:	
Purpose:	**Routine Assessment**	Dia/Height:	**8"**
Use:	**Sanitary**	Material:	**PVC**
Drain Area:	**NA**	Lining:	
Category:	**NA**		
Comment:	**Flow direction wrong**		
Location Details:		Direction of Survey:	**Downstream**

US MH: **M-208-025** DS MH: **M-208-026** Total Length Surveyed (ft): **158.4**

O&M Index:	**1.00**	O&M Quick:	**1200**	O&M Rating:	**2.00**
Structural Index:	**0.00**	Structural Quick:	**0000**	Structural Rating:	**0.00**
Overall Index:	**1.00**	Overall Quick:	**1200**	Overall Rating:	**2.00**

Position	Code	Observation	Video (sec)	Grade
M-208-025				
.0	AMH	Manhole	10	NA
.0	MWL	Water Level	21	NA
12.0	RFJ	Roots Fine Joint	56	M 1
52.0	RFJ	Roots Fine Joint	148	M 1
158.4	AMH	Manhole	372	NA
M-208-026				

Code:	**AMH**
Description:	**Manhole**
Distance (ft):	**.0**
Structural Grade:	**0**
O&M Grade:	**0**
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	**NO**
Remarks:	**M-208-025**

Code:	**MWL**
Description:	**Water Level**
Distance (ft):	**.0**
Structural Grade:	**0**
O&M Grade:	**0**
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	**5.000**
Continuous Index:	
Within 8" of Joint:	**NO**
Remarks:	

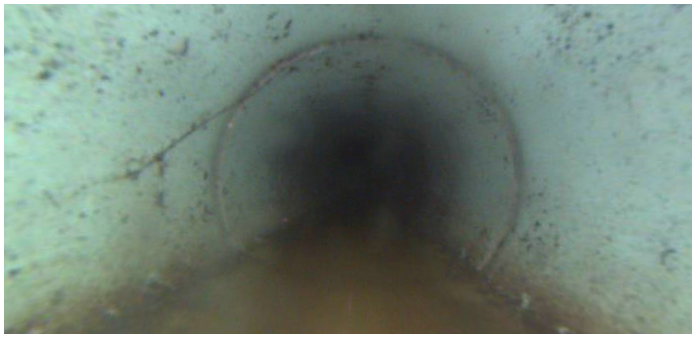

Code:	**RFJ**
Description:	**Roots Fine Joint**
Distance (ft):	**12.0**
Structural Grade:	**0**
O&M Grade:	**1**
Clock Start/From:	**12**
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	**YES**
Remarks:	

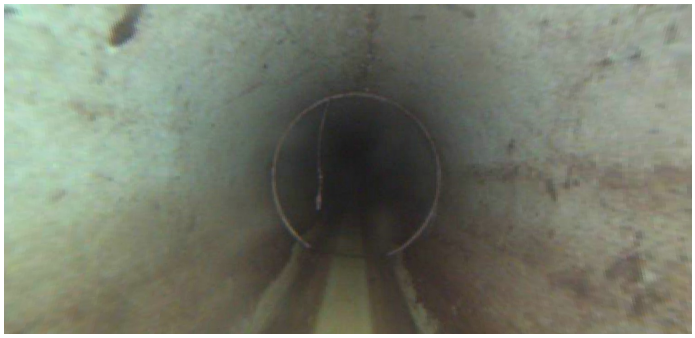

Code:	**RFJ**
Description:	**Roots Fine Joint**
Distance (ft):	**52.0**
Structural Grade:	**0**
O&M Grade:	**1**
Clock Start/From:	**11**
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	**YES**
Remarks:	

Code:	**AMH**
Description:	**Manhole**
Distance (ft):	**158.4**
Structural Grade:	**0**
O&M Grade:	**0**
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	**NO**
Remarks:	**M-208-026**