Profile/Photo Observation Report

RedZone ROBOTICS

Date:	**04/10/2018**	Weather:		Coding:	**PACP 6.0**
Pipe Length (ft):	**146.0**	Owner:	**NA**	Pre Clean:	**Not Known**
P.O.#:		Surveyor:	**Mark Ruby**	PSR:	**P-704-067-063**
Customer:		Clean Date:	**01/01/1900**	Shape:	**C**

Street:	**EDGEWATER DR**	Flow Control:	**Not Controlled**
City:	**Hobart, IN**	Year Renewed:	
Location:	**Other**	Tape/Media #:	
Purpose:	**Not Known**	Dia/Height:	**8"**
Use:	**Sanitary**	Material:	**PVC**
Drain Area:	**NA**	Lining:	
Category:	**NA**		
Comment:			
Location Details:		Direction of Survey:	**Downstream**
US MH:	**M-704-067**	DS MH: **M-704-063**	Total Length Surveyed (ft): **140.4**

O&M Index:	**2.00**	O&M Quick:	**2C00**	O&M Rating:	**40.00**
Structural Index:	**0.00**	Structural Quick:	**0000**	Structural Rating:	**0.00**
Overall Index:	**2.00**	Overall Quick:	**2C00**	Overall Rating:	**40.00**

	Position	Code	Observation	Video (sec)	Grade
	.0	AMH	Manhole	10	NA
	.0	MWL	Water Level	21	NA
	4.1	TF	Tap Factory	43	NA
	41.4	DAGS(S01)	Deposits Attached Grease	131	M 2
	140.4	DAGS(F01)	Deposits Attached Grease	345	M 2
	140.4	AMH	Manhole	356	NA

M-704-067

Camera Direction

M-704-063

Code:	**AMH**
Description:	**Manhole**
Distance (ft):	**.0**
Structural Grade:	**0**
O&M Grade:	**0**
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	**NO**
Remarks:	**M-704-067**

Code:	**MWL**
Description:	**Water Level**
Distance (ft):	**.0**
Structural Grade:	**0**
O&M Grade:	**0**
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	**10.000**
Continuous Index:	
Within 8" of Joint:	**NO**
Remarks:	
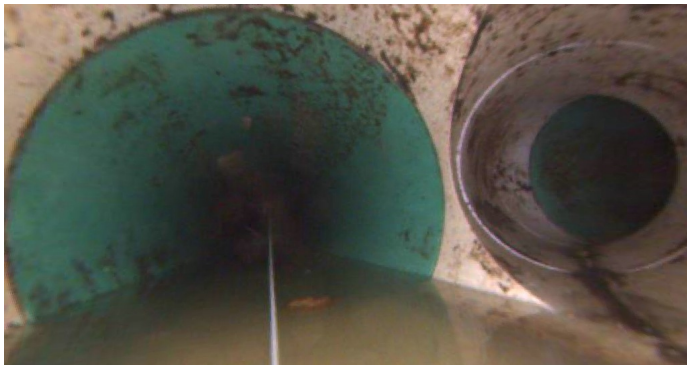
Code:	**TF**
Description:	**Tap Factory**
Distance (ft):	**4.1**
Structural Grade:	**0**
O&M Grade:	**0**
Clock Start/From:	**8**
Clock To:	
1st Value:	**4.000**
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	**NO**
Remarks:	

Code:	**DAGS**
Description:	**Deposits Attached Grease**
Distance (ft):	**41.4**
Structural Grade:	**0**
O&M Grade:	**2**
Clock Start/From:	**8**
Clock To:	**4**
1st Value:	
2nd Value:	
Value Percent:	**5.000**
Continuous Index:	**S01**
Within 8" of Joint:	**NO**
Remarks:	

Code:	**DAGS**
Description:	**Deposits Attached Grease**
Distance (ft):	**140.4**
Structural Grade:	**0**
O&M Grade:	**2**
Clock Start/From:	**8**
Clock To:	**4**
1st Value:	
2nd Value:	
Value Percent:	**5.000**
Continuous Index:	**F01**
Within 8" of Joint:	**NO**
Remarks:	

Code: **AMH**
Description: **Manhole**

Distance (ft): **140.4**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **M-704-063**