

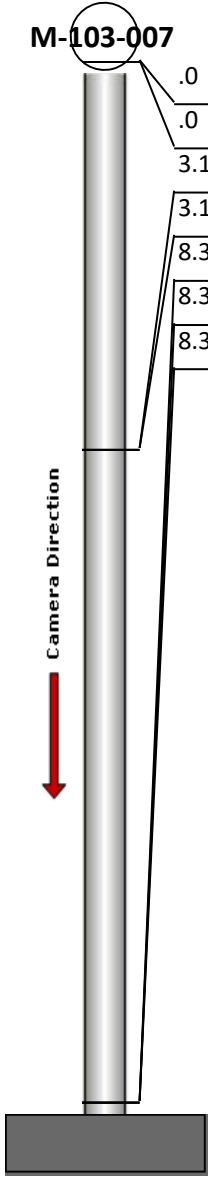
Manhole Inspection Report



Date:	10/04/2022	Weather:		Coding:	RZMACP
MH#:	M-103-007	Owner:	NA	Len. Surveyed:	8.3
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	10.2
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (cast in place)

Street:	Howard St. 166' South of 39th Ave.	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	2294387.905
Location:	Local Rural Streets	GPS Easting:	2891101.64
Drain Area:	Northwest	GPS Accuracy:	Sub-Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	24.0	Potential for Runoff:	None
Comments:			

O&M Index:	2.00	O&M Quick:	2200	O&M Rating:	4.00
Structural Index:	1.00	Structural Quick:	1800	Structural Rating:	8.00
Overall Index:	1.20	Overall Quick:	2218	Overall Rating:	12.00

	Position	Code	Observation	Video (sec)	Grade
	M-103-007				
	.0	MGO	General Observation	10	NA
	.0	SRI	Surface Roughness Increased	21	S 1
	3.1	IW	Infil Weeper	39	M 2
	3.1	MGO	General Observation	53	NA
	8.3	DSF	Deposits Settled Fine	77	M 2
	8.3	SRI	Surface Roughness Increased	88	S 1
	8.3	MGO	General Observation	100	NA



Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **access mh**



Code: **SRI**
Description: **Surface Roughness Increased**

Distance (ft): **.0**
Structural Grade: **1**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **IW**
Description: **Infil Weeper**

Distance (ft): **3.1**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**

Distance (ft): **3.1**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **underside of frame**

Code:	DSF
Description:	Deposits Settled Fine



Distance (ft):	8.3
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	NO
Remarks:	

Code:	SRI
Description:	Surface Roughness Increased



Distance (ft):	8.3
Structural Grade:	1
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

Code:	MGO
Description:	General Observation



Distance (ft):	8.3
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	end of survey