

Date:	04/17/2018	Weather:		Coding:	RZMACP
MH#:	M-203-052	Owner:	NA	Len. Surveyed:	6.0
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	7.6
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)
Street:	between Sandusky St. and Evergree Project:		Hobart, IN		
City:	Hobart, IN	(GPS Northing:	0.0	
Location:		(GPS Easting:	0.0	
Drain Area:	Northwest	(GPS Accuracy:	Nearest Meter	
Cover Shape:	Circular	E	Evidence of Surcharge:	No	
Cover Size: Comments:	23.0	F	Potential for Runoff:	None	
O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	1.00	Structural Quic	:k: 1100	Structural Rating:	1.00
Overall Index:	1.50	Overall Quick:	2111	Overall Rating:	3.00



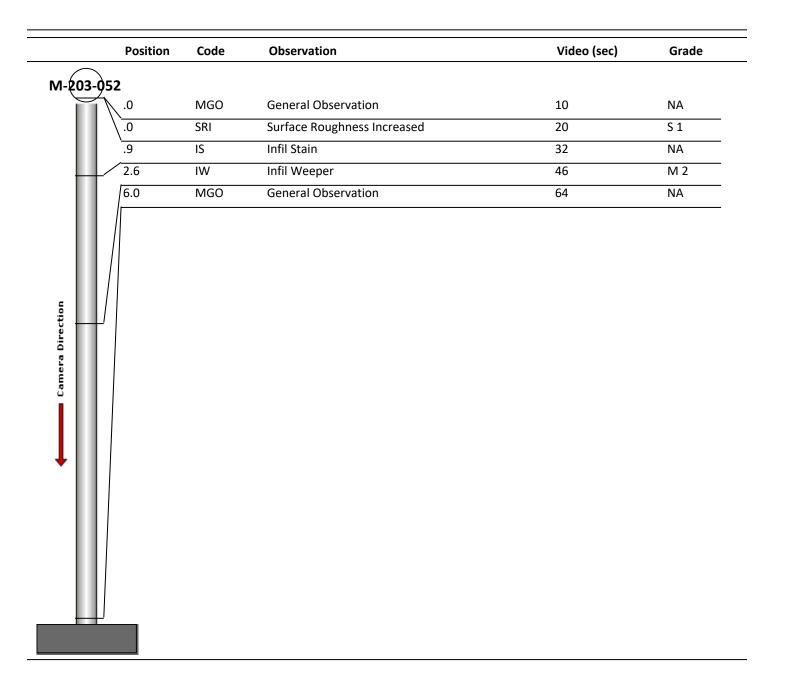

Code: Description:	MGO General Observation
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	ACCESS MH

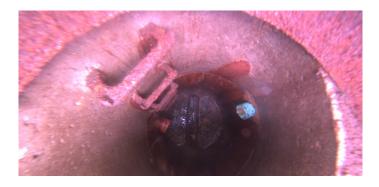

Code:SRIDescription:Surface Roughness Increased

Distance (ft):	.0	
Structural Grade:	1	
O&M Grade:	0	
Clock Start/From:	12	
Clock To:	12	
1st Value:		
2nd Value:		
Value Percent:		
Step:	NO	
Remarks:		



Code:	IS
Description:	Infil Stain
Distance (ft):	.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	1
Clock To: 1st Value:	
2nd Value: Value Percent:	
Step: Remarks:	NO



Code:	IW
Description:	Infil Weeper
Distance (ft):	2.6
. ,	
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code: Description: MGO General Observation

Distance (ft):	6.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	END SURVEY