

# Manhole Inspection Report




Date:	<b>04/17/2018</b>	Weather:		Coding:	<b>RZMACP</b>
MH#:	<b>M-203-057</b>	Owner:	<b>NA</b>	Len. Surveyed:	<b>2.4</b>
P.O.#:		Surveyor:	<b>Jen Costello</b>	Rim to Invert:	<b>3.4</b>
Customer:		Cert. #:	<b>U-907-5518</b>	Wall Material:	<b>Concrete (reinforced)</b>

Street:	<b>Alley between 37th Ave. and 38th A</b>	Project:	<b>Hobart, IN</b>
City:	<b>Hobart, IN</b>	GPS Northing:	<b>0.0</b>
Location:		GPS Easting:	<b>0.0</b>
Drain Area:	<b>Northwest</b>	GPS Accuracy:	<b>Nearest Meter</b>
Cover Shape:	<b>Circular</b>	Evidence of Surcharge:	<b>No</b>
Cover Size:	<b>23.0</b>	Potential for Runoff:	<b>None</b>
Comments:			

O&M Index:	<u>2.00</u>	O&M Quick:	<u>2100</u>	O&M Rating:	<u>2.00</u>
Structural Index:	<u>2.00</u>	Structural Quick:	<u>2100</u>	Structural Rating:	<u>2.00</u>
Overall Index:	<u>2.00</u>	Overall Quick:	<u>2200</u>	Overall Rating:	<u>4.00</u>

Position	Code	Observation	Video (sec)	Grade
<b>M-203-057</b>				
.0	MGO	General Observation	10	NA
.0	SSS	Surface Spalling	22	S 2
2.4	DSGV	Deposits Settled Gravel	38	M 2
2.4	MGO	General Observation	49	NA

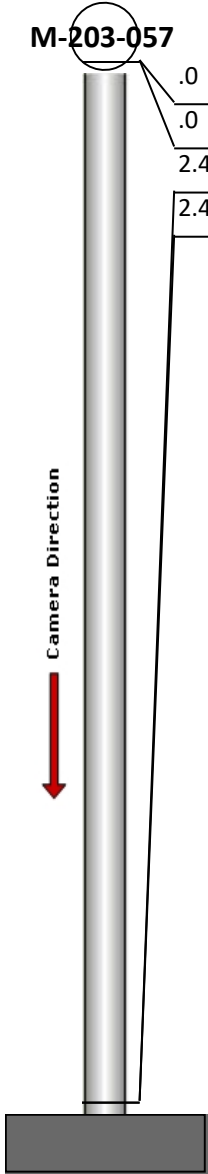


Code: **MGO**  
 Description: **General Observation**


Distance (ft): **.0**  
 Structural Grade: **0**  
 O&M Grade: **0**  
 Clock Start/From:  
 Clock To:  
 1st Value:  
 2nd Value:  
 Value Percent:  
 Step: **NO**  
 Remarks: **ACCESS MH**



Code: **SSS**  
Description: **Surface Spalling**

Distance (ft): **.0**  
Structural Grade: **2**  
O&M Grade: **0**  
Clock Start/From: **3**  
Clock To: **6**  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks:

---

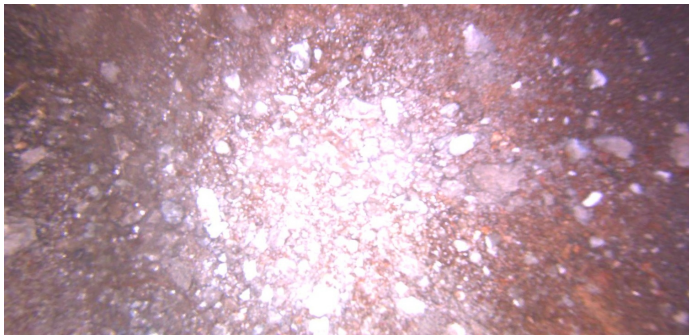

Code: **DSGV**  
Description: **Deposits Settled Gravel**

Distance (ft): **2.4**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **12**  
Clock To: **12**  
1st Value:  
2nd Value:  
Value Percent: **10.000**  
Step: **NO**  
Remarks:

---



Code: **MGO**  
Description: **General Observation**

Distance (ft): **2.4**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **END SURVEY**