


Manhole Inspection Report




Date:	10/06/2022	Weather:		Coding:	RZMACP
MH#:	M-303-018	Owner:	NA	Len. Surveyed:	6.8
P.O.#:		Surveyor:	Todd Machine	Rim to Invert:	7.6
Customer:		Cert. #:	P0038859-082022	Wall Material:	Concrete (reinforced)

Street:	Alley between Ridge Rd. and 40th A	Project:	Missing GPS
City:	Hobart, IN	GPS Northing:	41.54645157
Location:		GPS Easting:	-3.963961601
Drain Area:	Northwest	GPS Accuracy:	
Cover Shape:	Circular	Evidence of Surcharge:	
Cover Size:	24.0	Potential for Runoff:	
Comments:			


O&M Index:	2.00	O&M Quick:	2300	O&M Rating:	6.00
Structural Index:	1.00	Structural Quick:	1700	Structural Rating:	7.00
Overall Index:	1.30	Overall Quick:	2317	Overall Rating:	13.00

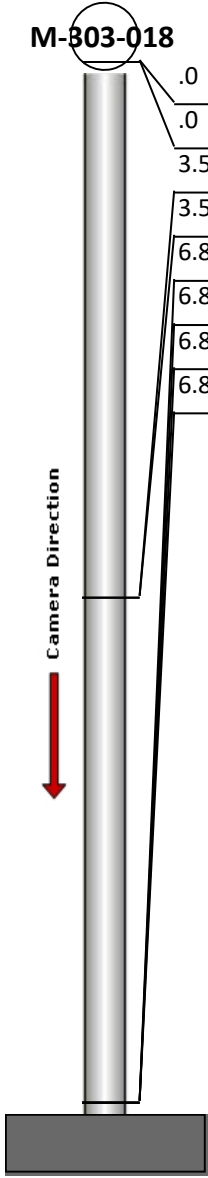	Position	Code	Observation	Video (sec)	Grade
	.0	MGO	General Observation	10	NA
	.0	SRI	Surface Roughness Increased	21	S 1
	3.5	MGO	General Observation	42	NA
	3.5	IW	Infil Weeper	55	M 2
	6.8	DSF	Deposits Settled Fine	74	M 2
	6.8	DSF	Deposits Settled Fine	86	M 2
	6.8	SRI	Surface Roughness Increased	97	S 1
	6.8	MGO	General Observation	108	NA

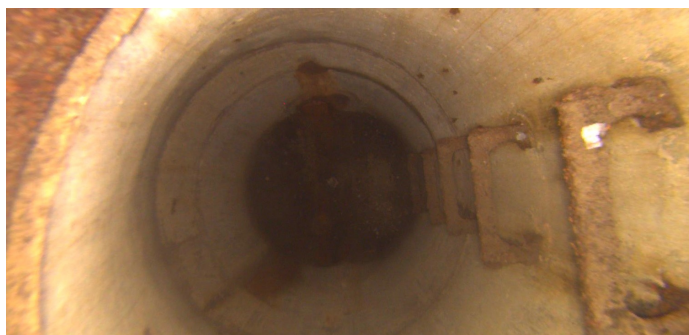

Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **access mh**

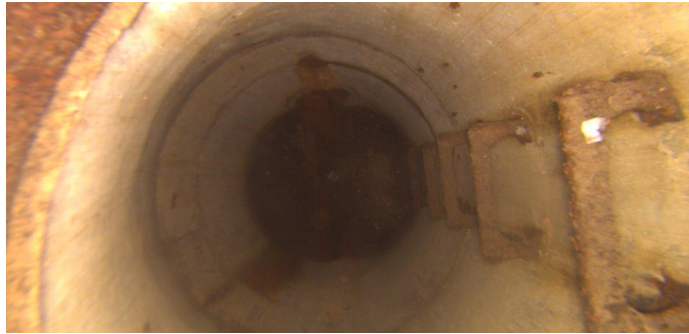


Code: **SRI**
Description: **Surface Roughness Increased**

Distance (ft): **.0**
Structural Grade: **1**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**


Distance (ft): **3.5**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **underside of frame**

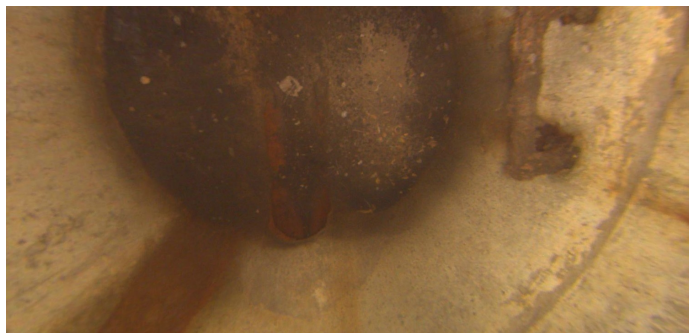

Code: **IW**
Description: **Infil Weeper**


Distance (ft): **3.5**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **7**
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:

Code:	DSF
Description:	Deposits Settled Fine

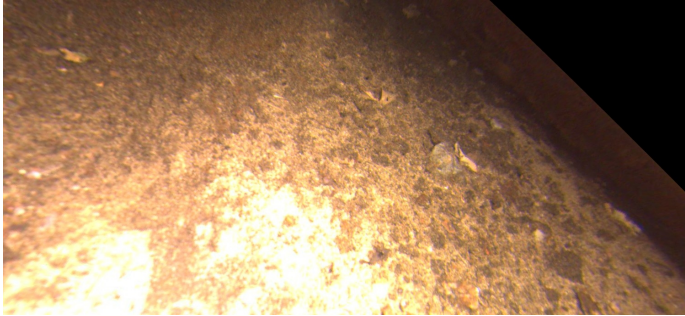


Distance (ft):	6.8
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	NO
Remarks:	

Code:	DSF
Description:	Deposits Settled Fine

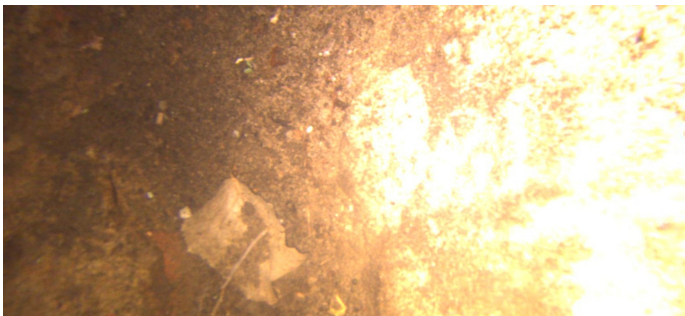


Distance (ft):	6.8
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	5
Clock To:	7
1st Value:	
2nd Value:	
Value Percent:	10.000
Step:	NO
Remarks:	

Code:	SRI
Description:	Surface Roughness Increased

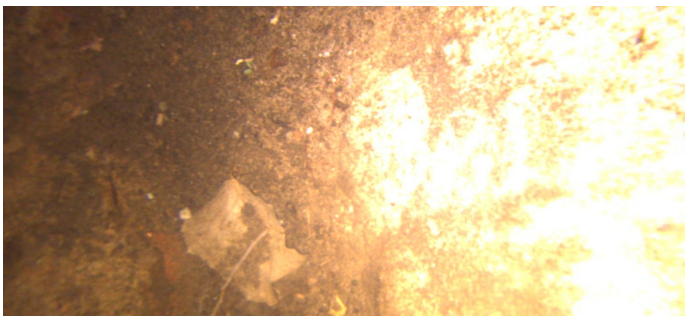

Distance (ft):	6.8
Structural Grade:	1
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	

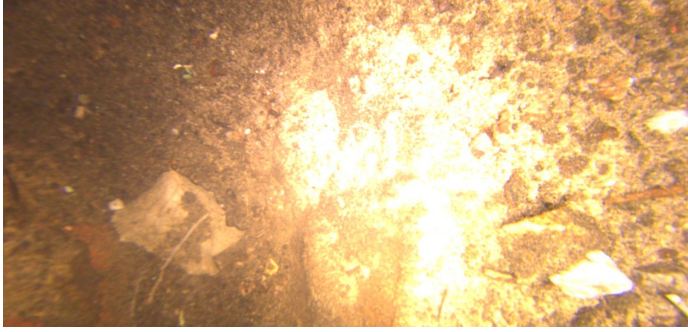

Code:	MGO
Description:	General Observation
Distance (ft):	6.8
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	End Of Survey