


Manhole Inspection Report



| | | | | | |
|-----------|-------------------|-----------|---------------------|----------------|---------------|
| Date: | 05/13/2018 | Weather: | | Coding: | RZMACP |
| MH#: | M-404-002 | Owner: | NA | Len. Surveyed: | 11.0 |
| P.O.#: | | Surveyor: | Jen Costello | Rim to Invert: | 11.5 |
| Customer: | | Cert. #: | U-907-5518 | Wall Material: | Brick |

| | | | |
|--------------|---|------------------------|----------------------|
| Street: | Cleveland Ave. 165' West of Wilson | Project: | Hobart, IN |
| City: | Hobart, IN | GPS Northing: | 41.53646469 |
| Location: | | GPS Easting: | -87.27879333 |
| Drain Area: | West | GPS Accuracy: | Nearest Meter |
| Cover Shape: | Circular | Evidence of Surcharge: | No |
| Cover Size: | 22.5 | Potential for Runoff: | None |
| Comments: | | | |


| | | | | | |
|-------------------|-------------|-------------------|-------------|--------------------|-------------|
| O&M Index: | 2.00 | O&M Quick: | 2100 | O&M Rating: | 2.00 |
| Structural Index: | 0.00 | Structural Quick: | 0000 | Structural Rating: | 0.00 |
| Overall Index: | 2.00 | Overall Quick: | 2100 | Overall Rating: | 2.00 |
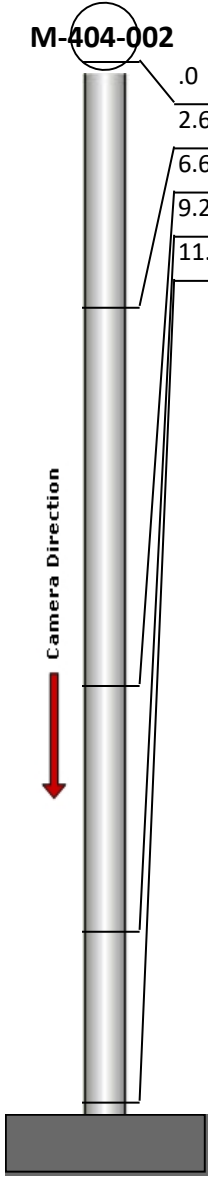
| | Position | Code | Observation | Video (sec) | Grade |
|--|----------|------|-------------------------|-------------|-------|
|  | .0 | MGO | General Observation | 10 | NA |
| | 2.6 | MGO | General Observation | 29 | NA |
| | 6.6 | MGO | General Observation | 50 | NA |
| | 9.2 | DSGV | Deposits Settled Gravel | 67 | M 2 |
| | 11.0 | MGO | General Observation | 82 | NA |



Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **access MH**

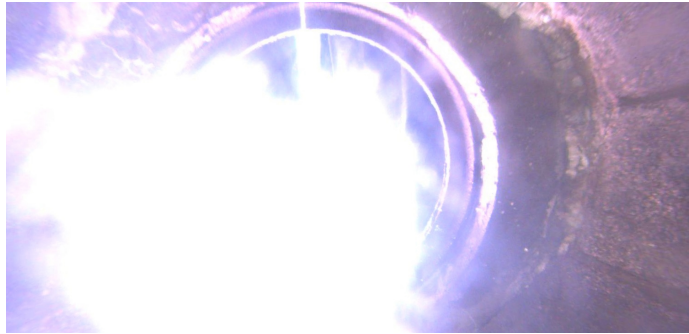

| | |
|-------------------|----------------------------|
| Code: | MGO |
| Description: | General Observation |
| Distance (ft): | 2.6 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | NO |
| Remarks: | UNDERSIDE OF FRAME |



| | |
|-------------------|---------------------------------|
| Code: | MGO |
| Description: | General Observation |
| Distance (ft): | 6.6 |
| Structural Grade: | 0 |
| O&M Grade: | 0 |
| Clock Start/From: | |
| Clock To: | |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | |
| Step: | YES |
| Remarks: | MISSING AND BROKEN STEPS |



| | |
|-------------------|--------------------------------|
| Code: | DSGV |
| Description: | Deposits Settled Gravel |
| Distance (ft): | 9.2 |
| Structural Grade: | 0 |
| O&M Grade: | 2 |
| Clock Start/From: | 12 |
| Clock To: | 12 |
| 1st Value: | |
| 2nd Value: | |
| Value Percent: | 5.000 |
| Step: | NO |
| Remarks: | |



Code: **MGO**
Description: **General Observation**

Distance (ft): **11.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **END SURVEY**