

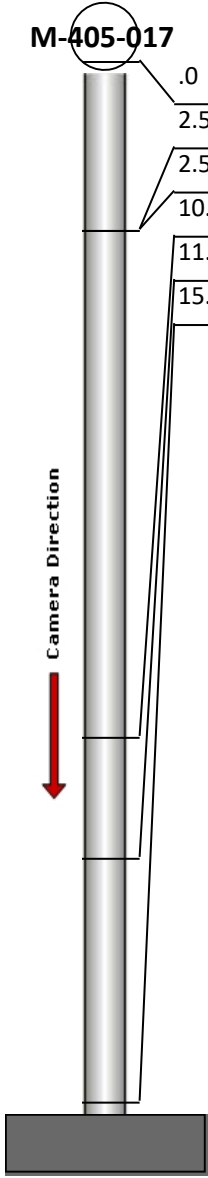
Manhole Inspection Report



Date:	05/17/2018	Weather:		Coding:	RZMACP
MH#:	M-405-017	Owner:	NA	Len. Surveyed:	15.4
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	15.5
Customer:		Cert. #:	U-907-5518	Wall Material:	Brick

Street:	618' South of 3rd St. East of LaSalle	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	2898244.559
Location:		GPS Easting:	2898244.559
Drain Area:	West	GPS Accuracy:	Sub-Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	24.0	Potential for Runoff:	None
Comments:			

O&M Index:	1.67	O&M Quick:	2211	O&M Rating:	5.00
Structural Index:	3.50	Structural Quick:	4131	Structural Rating:	7.00
Overall Index:	2.40	Overall Quick:	4131	Overall Rating:	12.00

	Position	Code	Observation	Video (sec)	Grade
	.0	MGO	General Observation	10	NA
	2.5	FM	Fracture Multiple	26	S 4
	2.5	FL	Fracture Longitudinal	38	S 3
	10.0	RFC	Roots Fine Connection	64	M 1
	11.8	RFB	Roots Fine Barrel	79	M 2
	15.4	DSF	Deposits Settled Fine	98	M 2



Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **ACCESS MH**



Code: **FM**
Description: **Fracture Multiple**

Distance (ft): **2.5**
Structural Grade: **4**
O&M Grade: **0**
Clock Start/From: **8**
Clock To: **9**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **FL**
Description: **Fracture Longitudinal**

Distance (ft): **2.5**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **3**
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **RFC**
Description: **Roots Fine Connection**

Distance (ft): **10.0**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **12**
Clock To: **1**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **RFB**
Description: **Roots Fine Barrel**

Distance (ft): **11.8**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **9**
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **DSF**
Description: **Deposits Settled Fine**

Distance (ft): **15.4**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent: **5.000**
Step: **NO**
Remarks: