


# Manhole Inspection Report



Date:	05/17/2018	Weather:		Coding:	RZMACP
MH#:	M-405-029	Owner:	NA	Len. Surveyed:	9.1
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	8.5
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)

Street:	350' North of Softwood Dr. and Drift	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	2897595.344
Location:		GPS Easting:	2897595.344
Drain Area:	West	GPS Accuracy:	Sub-Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	24.0	Potential for Runoff:	None
Comments:			

O&M Index:	2.50	O&M Quick:	4123	O&M Rating:	10.00
Structural Index:	0.00	Structural Quick:	0000	Structural Rating:	0.00
Overall Index:	2.50	Overall Quick:	4123	Overall Rating:	10.00

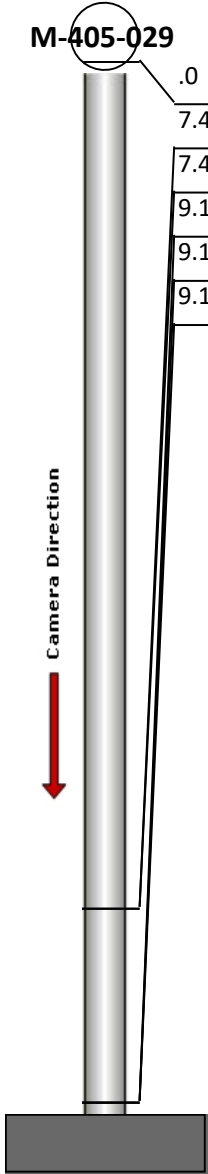	Position	Code	Observation	Video (sec)	Grade
	M-405-029				
	.0	MGO	General Observation	10	NA
	7.4	DSF	Deposits Settled Fine	35	M 2
	7.4	OBM	Obstacle Pipe Material	46	M 2
	9.1	MGO	General Observation	60	NA
	9.1	DAE	Deposits Attached Encrustation	71	M 2
	9.1	RMB	Roots Medium Barrel	81	M 4



Code: **MGO**  
Description: **General Observation**

Distance (ft): **.0**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **ACCESS MH**



Code: **DSF**  
Description: **Deposits Settled Fine**

Distance (ft): **7.4**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **12**  
Clock To: **12**  
1st Value:  
2nd Value:  
Value Percent: **5.000**  
Step: **NO**  
Remarks:

---



Code: **OBM**  
Description: **Obstacle Pipe Material**


Distance (ft): **7.4**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **8**  
Clock To: **2**  
1st Value:  
2nd Value:  
Value Percent: **5.000**  
Step: **NO**  
Remarks:

---




Code: **MGO**  
Description: **General Observation**

Distance (ft): **9.1**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **END SURVEY**

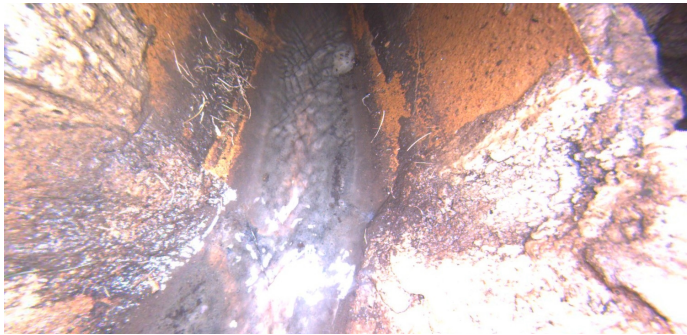

Code:	<b>DAE</b>
Description:	<b>Deposits Attached Encrustation</b>
Distance (ft):	<b>9.1</b>
Structural Grade:	<b>0</b>
O&M Grade:	<b>2</b>
Clock Start/From:	<b>3</b>
Clock To:	<b>6</b>
1st Value:	
2nd Value:	
Value Percent:	<b>5.000</b>
Step:	<b>NO</b>
Remarks:	

---

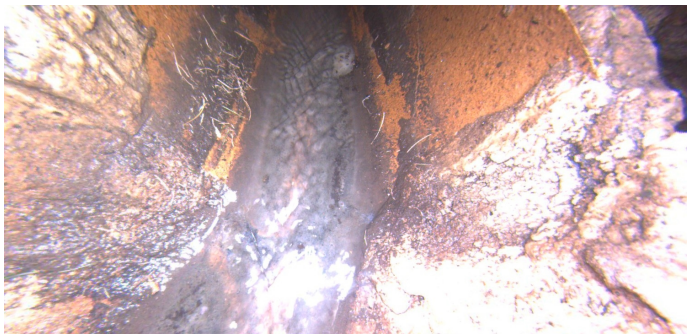

Code:	<b>RMB</b>
Description:	<b>Roots Medium Barrel</b>
Distance (ft):	<b>9.1</b>
Structural Grade:	<b>0</b>
O&M Grade:	<b>4</b>
Clock Start/From:	<b>7</b>
Clock To:	<b>10</b>
1st Value:	
2nd Value:	
Value Percent:	<b>5.000</b>
Step:	<b>NO</b>
Remarks:	