

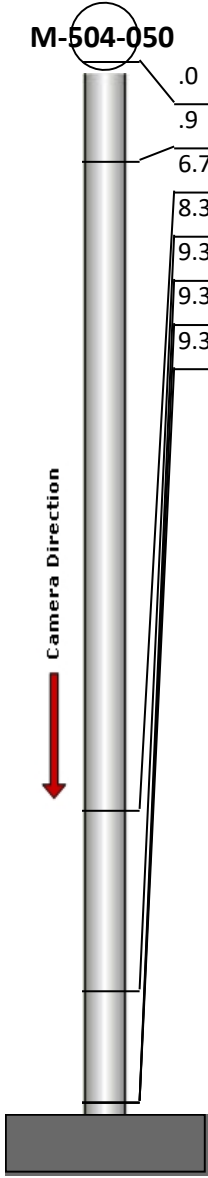
Manhole Inspection Report



Date:	05/14/2018	Weather:		Coding:	RZMACP
MH#:	M-504-050	Owner:	NA	Len. Surveyed:	9.3
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	9.2
Customer:		Cert. #:	U-907-5518	Wall Material:	Brick

Street:	South of Old Ridge Rd. 167' East of C	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	41.53991318
Location:		GPS Easting:	-87.27532959
Drain Area:	West	GPS Accuracy:	Nearest Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	22.5	Potential for Runoff:	None
Comments:			

O&M Index:	2.00	O&M Quick:	2300	O&M Rating:	6.00
Structural Index:	3.00	Structural Quick:	3800	Structural Rating:	24.00
Overall Index:	2.73	Overall Quick:	3823	Overall Rating:	30.00

	Position	Code	Observation	Video (sec)	Grade
	.0	MGO	General Observation	10	NA
	.9	SAV	Surface Aggregate Visible	23	S 3
	6.7	DAR	Deposits Attached Ragging	45	M 2
	8.3	RFB	Roots Fine Barrel	59	M 2
	9.3	DSF	Deposits Settled Fine	73	M 2
	9.3	SAV	Surface Aggregate Visible	83	S 3
	9.3	MGO	General Observation	94	NA



Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **ACCESS MH**



Code:	SAV
Description:	Surface Aggregate Visible
Distance (ft):	.9
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	12
Clock To:	12
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code:	DAR
Description:	Deposits Attached Ragging
Distance (ft):	6.7
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	1
Clock To:	3
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	YES
Remarks:	



Code:	RFB
Description:	Roots Fine Barrel
Distance (ft):	8.3
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	12
Clock To:	3
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	



Code: **DSF**
Description: **Deposits Settled Fine**

Distance (ft): **9.3**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent: **5.000**
Step: **NO**
Remarks:



Code: **SAV**
Description: **Surface Aggregate Visible**

Distance (ft): **9.3**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**

Distance (ft): **9.3**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **END SURVEY**