

Manhole Inspection Report



Date:	04/29/2018	Weather:		Coding:	RZMACP
MH#:	M-604-116	Owner:	NA	Len. Surveyed:	4.2
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	4.1
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)

Street:	Cleveland Ave. and Connecticut St. t	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	2902989.505
Location:		GPS Easting:	2902989.505
Drain Area:	West	GPS Accuracy:	Sub-Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	22.5	Potential for Runoff:	None
Comments:			

O&M Index:	<u>2.00</u>	O&M Quick:	<u>2100</u>	O&M Rating:	<u>2.00</u>
Structural Index:	<u>3.00</u>	Structural Quick:	<u>3200</u>	Structural Rating:	<u>6.00</u>
Overall Index:	<u>2.67</u>	Overall Quick:	<u>3221</u>	Overall Rating:	<u>8.00</u>

Position	Code	Observation	Video (sec)	Grade
M-604-116 .0	MGO	General Observation	10	NA
1.3	SAV	Surface Aggregate Visible	24	S 3
1.3	MGO	General Observation	37	NA
2.5	OBR	Obstacle Rocks	53	M 2
3.9	SAP	Surface Aggregate Projecting	67	S 3
4.2	MGO	General Observation	79	NA




Code: **MGO**
Description: **General Observation**

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **access MH**



Code: **SAV**
Description: **Surface Aggregate Visible**

Distance (ft): **1.3**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:

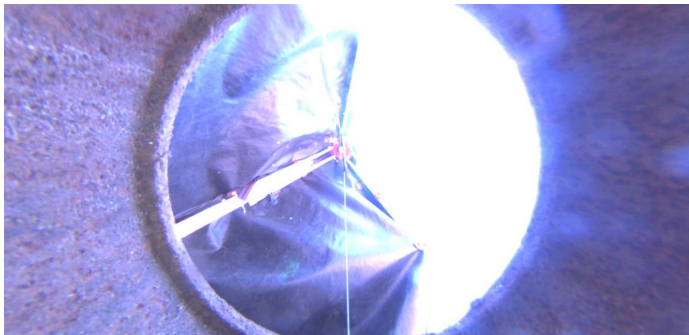


Code: **MGO**
Description: **General Observation**

Distance (ft): **1.3**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **UNDERSIDE OF FRAME**



Code: **OBR**
Description: **Obstacle Rocks**

Distance (ft): **2.5**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **2**
Clock To: **4**
1st Value:
2nd Value:
Value Percent: **5.000**
Step: **NO**
Remarks:

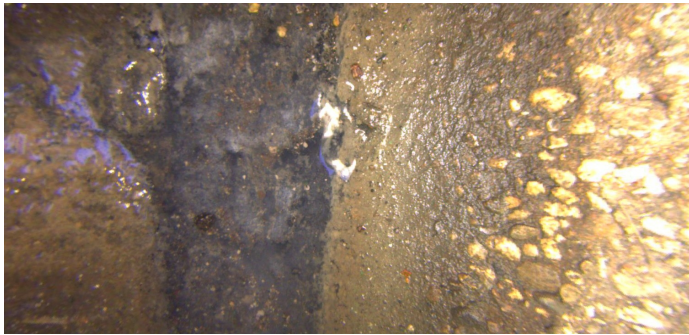

Code: **SAP**
Description: **Surface Aggregate Projecting**

Distance (ft): **3.9**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **3**
Clock To: **9**
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks:



Code: **MGO**
Description: **General Observation**

Distance (ft): **4.2**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Step: **NO**
Remarks: **END SURVEY**