Manhole Inspection Report



Date: 04/30/2018 Weather: Coding: RZMACP

 MH#:
 M-605-051
 Owner:
 NA
 Len. Surveyed:
 11.0

 P.O.#:
 Surveyor:
 Jen Costello
 Rim to Invert:
 11.7

 Customer:
 Cert. #:
 U-907-5518
 Wall Material:
 Brick

Street: Wisconsin St. 218' North of 2nd St. Project: Hobart, IN
City: Hobart, IN GPS Northing: 2901828.075

Location: GPS Easting: **2901828.075**

Drain Area: West GPS Accuracy: Sub-Meter Cover Shape: Circular Evidence of Surcharge: No


Cover Size: 22.5 Potential for Runoff: None

Comments:

O&M Index:	2.00	O&M Quick:	2100	O&M Rating:	2.00
Structural Index:	3.00	Structural Quick:	3100	Structural Rating:	3.00
Overall Index:	2.50	Overall Quick:	3121	Overall Rating:	5.00

Wednesday, May 3, 2023

	Position	Code	Observation	Video (sec)	Grade
I- 6 05-051	L				
	.0	MGP	General Photo	10	NA
	.0	DB	Displaced Brick	21	S 3
-11	1.4	MGO	General Observation	37	NA
	9.2	DSF	Deposits Settled Fine	66	M 2
-11	11.0	MGO	General Observation	81	NA

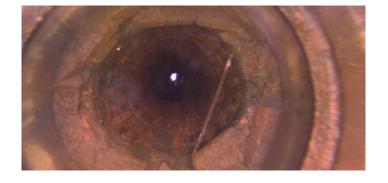


Description:	General Photo
Distance (ft): Structural Grade:	.0 0
O&M Grade:	0
Clock Start/From: Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	ACCESS MH

MGP

Wednesday, May 3, 2023

Code:

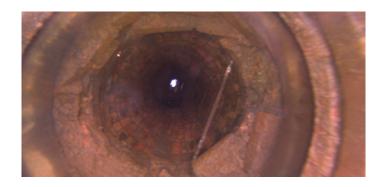

Code: **DB**

Description: Displaced Brick

Distance (ft): .0
Structural Grade: 3
O&M Grade: 0
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value: Value Percent:

Step: NO

Remarks:



Code: MGO

Description: General Observation

Distance (ft): 1.4
Structural Grade: 0
O&M Grade: 0
Clock Start/From:
Clock To:

1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: UNDERSIDE OF FRAME



Code: **DSF**

Description: Deposits Settled Fine

Distance (ft): 9.2
Structural Grade: 0
O&M Grade: 2
Clock Start/From: 12
Clock To: 12
1st Value:

2nd Value:

Value Percent: 5.000 Step: NO

Remarks:

Wednesday, May 3, 2023 3



Code: MGO

Description: General Observation

Distance (ft): 11.0
Structural Grade: 0
O&M Grade: 0

Clock Start/From:

Clock To: 1st Value: 2nd Value: Value Percent:

Step: NO

Remarks: END SURVEY

4