


# Manhole Inspection Report




Date:	05/03/2018	Weather:		Coding:	RZMACP
MH#:	M-705-033	Owner:	NA	Len. Surveyed:	9.3
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	10.0
Customer:		Cert. #:	U-907-5518	Wall Material:	Brick

Street:	Intersection of Center St. and 3rd St.	Project:	Hobart, IN
City:	Hobart, IN	GPS Northing:	41.53248978
Location:		GPS Easting:	-87.25369263
Drain Area:	South	GPS Accuracy:	Nearest Meter
Cover Shape:	Circular	Evidence of Surcharge:	No
Cover Size:	22.5	Potential for Runoff:	None
Comments:			


O&M Index:	2.50	O&M Quick:	3121	O&M Rating:	5.00
Structural Index:	0.00	Structural Quick:	0000	Structural Rating:	0.00
Overall Index:	2.50	Overall Quick:	3121	Overall Rating:	5.00

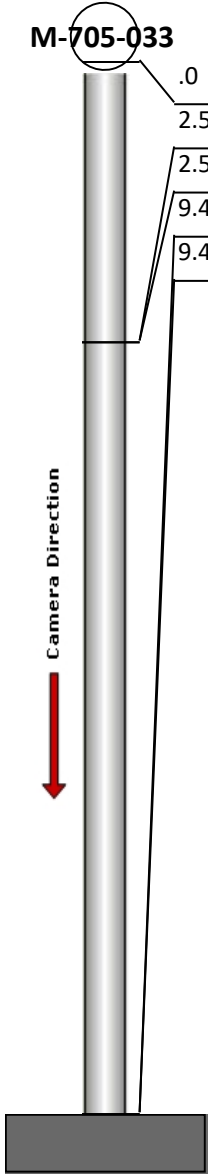	Position	Code	Observation	Video (sec)	Grade
	M-705-033				
	.0	MGP	General Photo	10	NA
	2.5	IS	Infil Stain	27	NA
	2.5	DAE	Deposits Attached Encrustation	38	M 2
	9.4	DSZ	Deposits Settled Other	64	M 3
	9.4	MGO	General Observation	75	NA

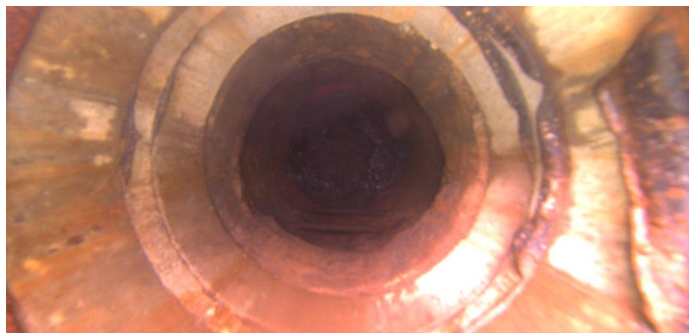

Code: **MGP**  
Description: **General Photo**

Distance (ft): **.0**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **ACCESS MH**

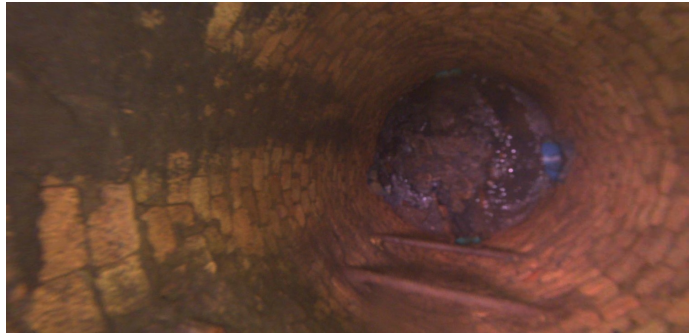

Code: **IS**  
Description: **Infil Stain**

Distance (ft): **2.5**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From: **10**  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks:



Code: **DAE**  
Description: **Deposits Attached Encrustation**

Distance (ft): **2.5**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **6**  
Clock To: **8**  
1st Value:  
2nd Value:  
Value Percent: **5.000**  
Step: **NO**  
Remarks:



Code: **DSZ**  
Description: **Deposits Settled Other**

Distance (ft): **9.4**  
Structural Grade: **0**  
O&M Grade: **3**  
Clock Start/From: **12**  
Clock To: **12**  
1st Value:  
2nd Value:  
Value Percent: **20.000**  
Step: **NO**  
Remarks: **MISC**



Code: **MGO**  
Description: **General Observation**

Distance (ft): **9.4**

Structural Grade: **0**

O&M Grade: **0**

Clock Start/From:

Clock To:

1st Value:

2nd Value:

Value Percent:

Step: **NO**

Remarks: **END SURVEY**