

# Manhole Inspection Report



Date:	<b>05/04/2018</b>	Weather:		Coding:	<b>RZMACP</b>
MH#:	<b>M-705-057</b>	Owner:	<b>NA</b>	Len. Surveyed:	<b>15.1</b>
P.O.#:		Surveyor:	<b>Jen Costello</b>	Rim to Invert:	<b>20.3</b>
Customer:		Cert. #:	<b>U-907-5518</b>	Wall Material:	<b>Concrete (reinforced)</b>

Street:	<b>105' North of Cleveland Ave. East of</b>	Project:	<b>Hobart, IN</b>
City:	<b>Hobart, IN</b>	GPS Northing:	<b>2905872.334</b>
Location:		GPS Easting:	<b>2905872.334</b>
Drain Area:	<b>South</b>	GPS Accuracy:	<b>Sub-Meter</b>
Cover Shape:	<b>Circular</b>	Evidence of Surcharge:	<b>No</b>
Cover Size:	<b>22.5</b>	Potential for Runoff:	<b>None</b>
Comments:			

O&M Index:	<b>2.00</b>	O&M Quick:	<b>2200</b>	O&M Rating:	<b>4.00</b>
Structural Index:	<b>1.00</b>	Structural Quick:	<b>1A00</b>	Structural Rating:	<b>14.00</b>
Overall Index:	<b>1.13</b>	Overall Quick:	<b>221A</b>	Overall Rating:	<b>18.00</b>

	Position	Code	Observation	Video (sec)	Grade
	.0	MGP	General Photo	10	NA
	.8	SRI	Surface Roughness Increased	23	S 1
	2.3	MGO	General Observation	40	NA
	12.0	DAR	Deposits Attached Ragging	73	M 2
	12.6	IW	Infil Weeper	86	M 2
	15.1	MGO	General Observation	103	NA
	15.1	SRI	Surface Roughness Increased	114	S 1




Code: **MGP**  
Description: **General Photo**

Distance (ft): **.0**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **ACCESS MH**



Code: **SRI**  
Description: **Surface Roughness Increased**

Distance (ft): **.8**  
Structural Grade: **1**  
O&M Grade: **0**  
Clock Start/From: **12**  
Clock To: **12**  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks:

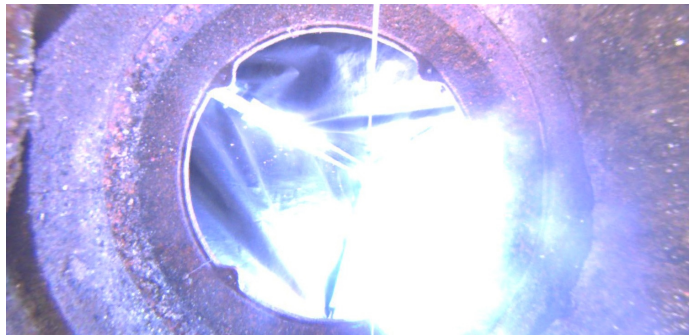

Code: **MGO**  
Description: **General Observation**

Distance (ft): **2.3**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **UNDERSIDE OF FRAME**



Code: **DAR**  
Description: **Deposits Attached Ragging**

Distance (ft): **12.0**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **2**  
Clock To: **4**  
1st Value:  
2nd Value:  
Value Percent: **10.000**  
Step: **YES**  
Remarks:



Code: **IW**  
Description: **Infil Weeper**

Distance (ft): **12.6**  
Structural Grade: **0**  
O&M Grade: **2**  
Clock Start/From: **12**  
Clock To: **1**  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks:

---



Code: **MGO**  
Description: **General Observation**

Distance (ft): **15.1**  
Structural Grade: **0**  
O&M Grade: **0**  
Clock Start/From:  
Clock To:  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: **END SURVEY**

---



Code: **SRI**  
Description: **Surface Roughness Increased**

Distance (ft): **15.1**  
Structural Grade: **1**  
O&M Grade: **0**  
Clock Start/From: **12**  
Clock To: **12**  
1st Value:  
2nd Value:  
Value Percent:  
Step: **NO**  
Remarks: