
Date:	05/10/2018	Weather:		Coding:	RZMACP
MH#:	M-905-003	Owner:	NA	Len. Surveyed:	10.9
P.O.#:		Surveyor:	Jen Costello	Rim to Invert:	11.6
Customer:		Cert. #:	U-907-5518	Wall Material:	Concrete (reinforced)
Street:	State Rd. 130. 549'	East of Sullivan S	Project:	Hobart, IN	
City:	Hobart, IN	(	GPS Northing:	2912223.625	
Location:		(	GPS Easting:	2912223.625	
Drain Area:	Southeast	(	GPS Accuracy:	Sub-Meter	
Cover Shape:	Circular	E	Evidence of Surcharge:	No	
Cover Size: Comments:	22.5	I	Potential for Runoff:	None	
O&M Index:	2.00	O&M Quick:	2200	O&M Rating:	4.00
Structural Index:	0.00	Structural Quid	ck: 0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Quick:	2200	Overall Rating:	4.00

Position	Code	Observation	Video (sec)	Grade
905-003				
0.	MGP	General Photo	10	NA
1.6	MGO	General Observation	26	NA
8.1	IW	Infil Weeper	53	M 2
8.1	DAR	Deposits Attached Ragging	65	M 2
10.9	MGO	General Observation	82	NA



Code:	MGP
Description:	General Photo
	_
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	ACCESS MH

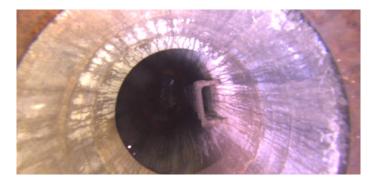

Code:MGODescription:General Observation

Distance (ft):	1.6
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	UNDERSIDE OF FRAME



Code: Description:	IW Infil Weeper
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent:	8.1 0 2 12
Step: Remarks:	NO



Code: Description:	DAR Deposits Attached Ragging
Distance (ft):	8.1
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	3
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Step:	YES
Remarks:	



Code: Description:	MGO General Observation
Distance (ft):	10.9
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Step:	NO
Remarks:	END SURVEY