

Profile/Photo Observation Report




Date:	04/07/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	208.1	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Mark Ruby	PSR:	P-503-039-040
Customer:		Clean Date:	01/01/1900	Shape:	C

Street:	canender st	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Other	Tape/Media #:	
Purpose:	Not Known	Dia/Height:	10"
Use:	Sanitary	Material:	VCP
Drain Area:	NA	Lining:	
Category:	NA		
Comment:			

Location Details:		Direction of Survey:	Upstream
US MH:	M-503-040	DS MH:	M-503-039
		Total Length Surveyed (ft):	207.2

O&M Index:	1.98	O&M Quick:	2111	O&M Rating:	103.00
Structural Index:	0.00	Structural Quick:	0000	Structural Rating:	0.00
Overall Index:	1.98	Overall Quick:	2111	Overall Rating:	103.00

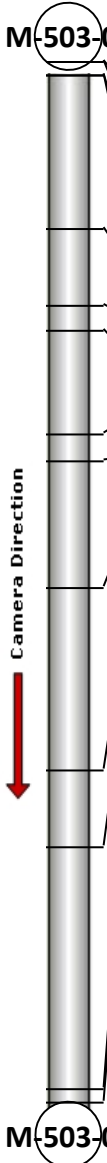	Position	Code	Observation	Video (sec)	Grade
M-503-039					
	.0	AMH	Manhole	10	NA
	.0	MWL	Water Level	21	NA
	2.6	IW(S02)	Infil Weeper	38	M 2
	2.7	DAZ	Deposits Attached Other	49	M 2
	33.2	DAZ	Deposits Attached Other	122	M 2
	48.6	DAZ	Deposits Attached Other	164	M 2
	53.7	DAZ(S01)	Deposits Attached Other	186	M 2
	74.2	RFJ	Roots Fine Joint	238	M 1
	79.5	DAZ(F01)	Deposits Attached Other	260	M 2
	104.9	DAZ	Deposits Attached Other	322	M 2
	140.9	DAZ	Deposits Attached Other	405	M 2
	156.5	DAZ	Deposits Attached Other	448	M 2
	204.5	IW(F02)	Infil Weeper	555	M 2
	207.2	AMH	Manhole	572	NA
M-503-040					




Code: **AMH**
 Description: **Manhole**


 Distance (ft): **.0**
 Structural Grade: **0**
 O&M Grade: **0**
 Clock Start/From:
 Clock To:
 1st Value:
 2nd Value:
 Value Percent:
 Continuous Index:
 Within 8" of Joint: **NO**
 Remarks: **M-503-039**



Code:	MWL
Description:	Water Level
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

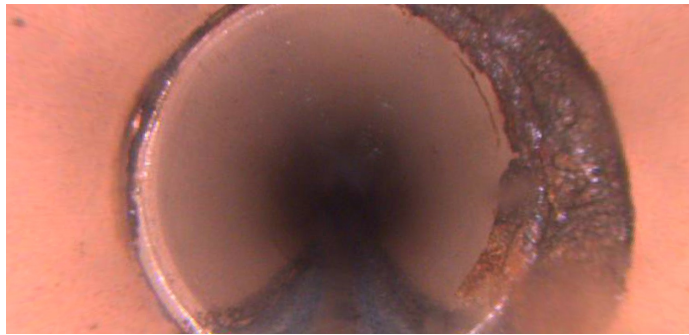


Code:	IW
Description:	Infil Weeper
Distance (ft):	2.6
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	S02
Within 8" of Joint:	YES
Remarks:	

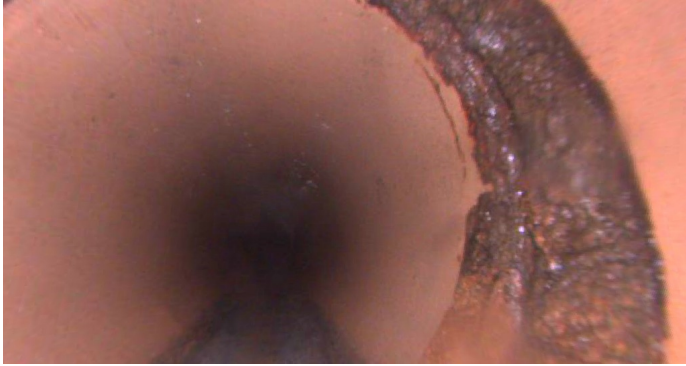


Code: **DAZ**
Description: **Deposits Attached Other**

Distance (ft): **2.7**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **12**
Clock To: **5**
1st Value:
2nd Value:
Value Percent: **5.000**
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

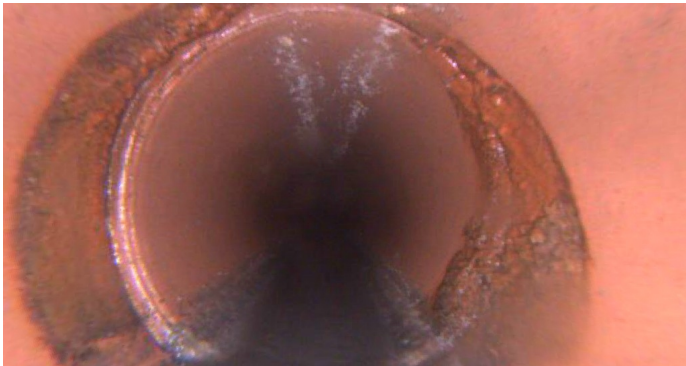


Code: **DAZ**
Description: **Deposits Attached Other**

Distance (ft): **33.2**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **7**
Clock To: **5**
1st Value:
2nd Value:
Value Percent: **5.000**
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

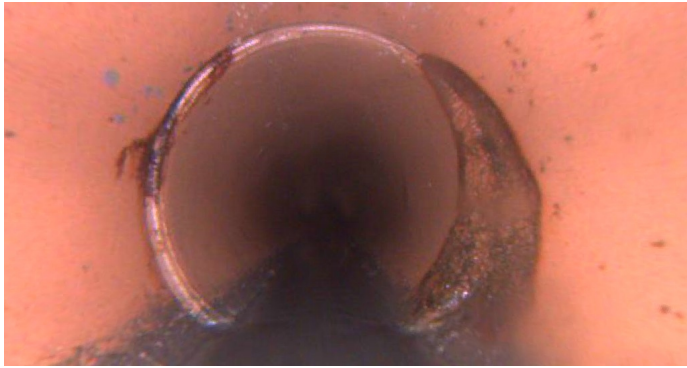


Code:	DAZ
Description:	Deposits Attached Other
Distance (ft):	48.6
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	1
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

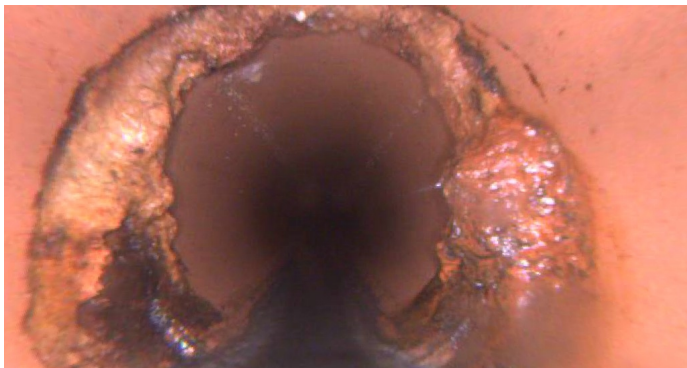

Code:	DAZ
Description:	Deposits Attached Other
Distance (ft):	53.7
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	S01
Within 8" of Joint:	YES
Remarks:	

Code: **RFJ**
Description: **Roots Fine Joint**

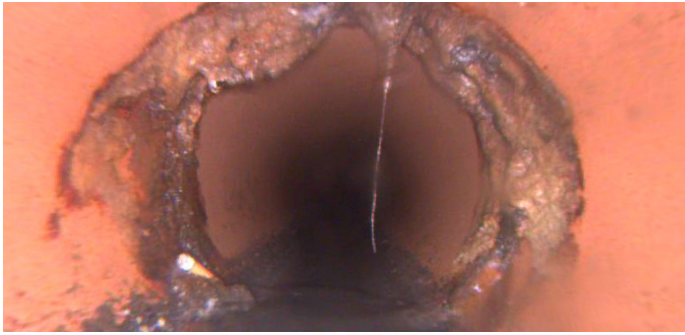


Distance (ft): **74.2**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **12**
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

Code: **DAZ**
Description: **Deposits Attached Other**



Distance (ft): **79.5**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **7**
Clock To: **5**
1st Value:
2nd Value:
Value Percent: **5.000**
Continuous Index: **F01**
Within 8" of Joint: **YES**
Remarks:

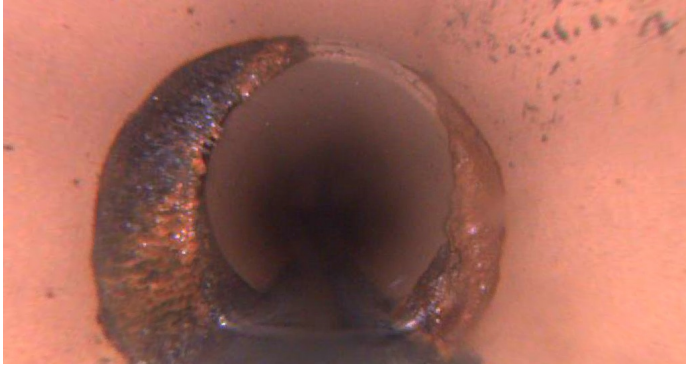


Code:	DAZ
Description:	Deposits Attached Other
Distance (ft):	104.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	5
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:	DAZ
Description:	Deposits Attached Other
Distance (ft):	140.9
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	7
Clock To:	11
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

Code: **DAZ**
Description: **Deposits Attached Other**

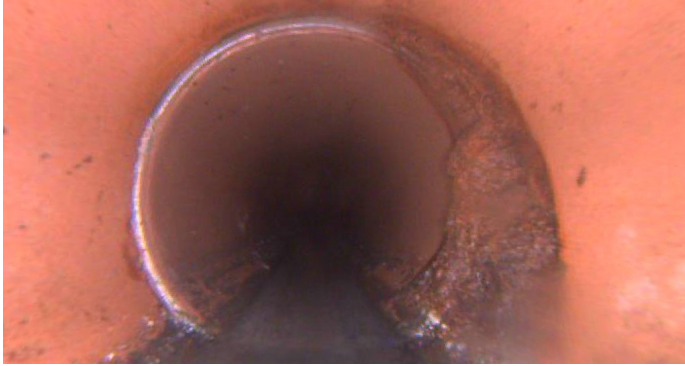


Distance (ft): **156.5**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **1**
Clock To: **5**
1st Value:
2nd Value:
Value Percent: **5.000**
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

Code: **IW**
Description: **Infil Weeper**



Distance (ft): **204.5**
Structural Grade: **0**
O&M Grade: **2**
Clock Start/From: **8**
Clock To: **4**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **F02**
Within 8" of Joint: **YES**
Remarks:

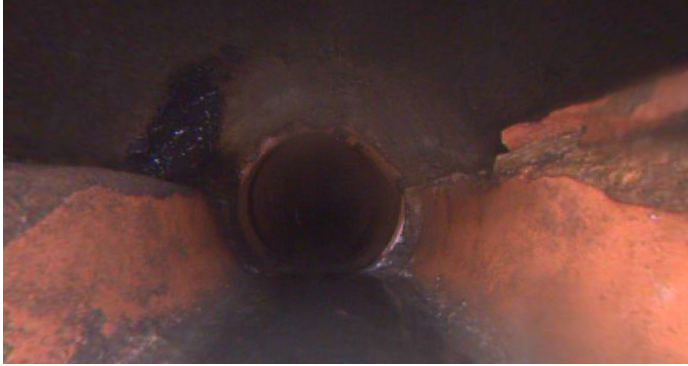

Code:	AMH
Description:	Manhole
Distance (ft):	207.2
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-503-040