

Profile/Photo Observation Report




Date:	04/18/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	281.7	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Byrd Fitzgerald	PSR:	P-504-105-130
Customer:		Clean Date:	01/01/1900	Shape:	Z

Street:	W 42ND AVE & N VIRGINIA ST	Flow Control:	Not Controlled		
City:	Hobart, IN	Year Renewed:			
Location:	Light Highway	Tape/Media #:			
Purpose:	Not Known	Dia/Height:	10"		
Use:	Sanitary	Material:	CP		
Drain Area:	NA	Lining:			
Category:	NA				
Comment:					
Location Details:		Direction of Survey:	Downstream		
US MH:	M-504-130	DS MH:	M-504-105	Total Length Surveyed (ft):	3.5

O&M Index:	0.00	O&M Quick:	0000	O&M Rating:	0.00
Structural Index:	3.00	Structural Quick:	3100	Structural Rating:	3.00
Overall Index:	3.00	Overall Quick:	3100	Overall Rating:	3.00

Position	Code	Observation	Video (sec)	Grade
M-504-130				
.0	SAP	Surface Aggregate Projecting	10	S 3
.0	AMH	Manhole	21	NA
.0	MWL	Water Level	32	NA
3.5	MMC	Material Change	51	NA
3.5	MSA	Abandoned Survey	62	NA

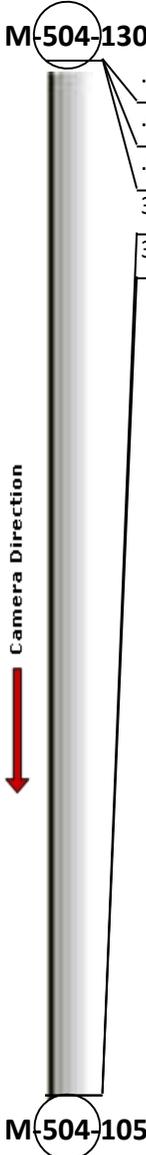

Code: **SAP**
Description: **Surface Aggregate Projecting**



Distance (ft): **.0**
Structural Grade: **3**
O&M Grade: **0**
Clock Start/From: **7**
Clock To: **5**
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint:
Remarks:

Code: **AMH**
Description: **Manhole**



Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **M-504-130**

Code: **MWL**
Description: **Water Level**



Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent: **5.000**
Continuous Index:
Within 8" of Joint: **NO**
Remarks:



Code: **MMC**
Description: **Material Change**

Distance (ft): **3.5**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **camera glitch material change to pvc exact footage of change unknown**



Code: **MSA**
Description: **Abandoned Survey**

Distance (ft): **3.5**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **no blockage**