

Profile/Photo Observation Report




Date:	04/25/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft):	254.4	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-604-120-121
Customer:		Clean Date:	01/01/1900	Shape:	C

Street:	N LAKE PARK AVE	Flow Control:	Not Controlled
City:	Hobart, IN	Year Renewed:	
Location:	Other	Tape/Media #:	
Purpose:	Not Known	Dia/Height:	8"
Use:	Sanitary	Material:	CP
Drain Area:	NA	Lining:	
Category:	NA		
Comment:			

Location Details:		Direction of Survey:	Downstream
US MH:	M-604-120	DS MH:	M-604-121
		Total Length Surveyed (ft):	3.4

O&M Index:	4.00	O&M Quick:	4100	O&M Rating:	4.00
Structural Index:	3.00	Structural Quick:	3100	Structural Rating:	3.00
Overall Index:	3.50	Overall Quick:	4131	Overall Rating:	7.00

	Position	Code	Observation	Video (sec)	Grade
	M-604-120				
	.0	AMH	Manhole	10	NA
	.0	MWL	Water Level	21	NA
	.0	SAP	Surface Aggregate Projecting	32	S 3
	.0	RBJ	Roots Ball Joint	44	M 4
	3.4	MSA	Abandoned Survey	62	NA
M-604-121					

Code: AMH

Description: Manhole



Distance (ft): .0

Structural Grade: 0

O&M Grade: 0

Clock Start/From:

Clock To:

1st Value:

2nd Value:


Value Percent:

Continuous Index:

Within 8" of Joint: NO


Remarks: M-604-120

Code:	MWL
Description:	Water Level

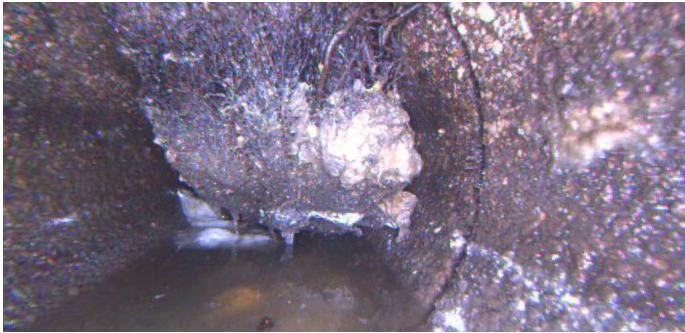


Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

Code:	SAP
Description:	Surface Aggregate Projecting

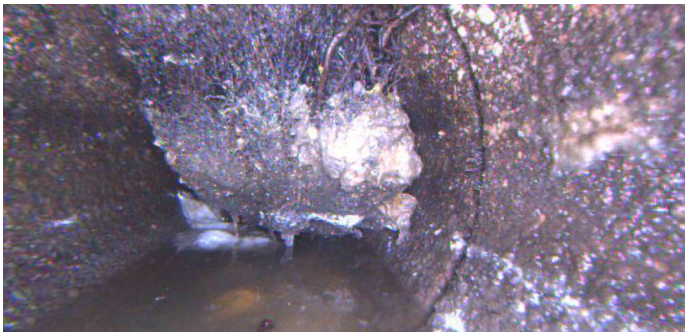


Distance (ft):	.0
Structural Grade:	3
O&M Grade:	0
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	
Remarks:	

Code: **RBJ**
Description: **Roots Ball Joint**

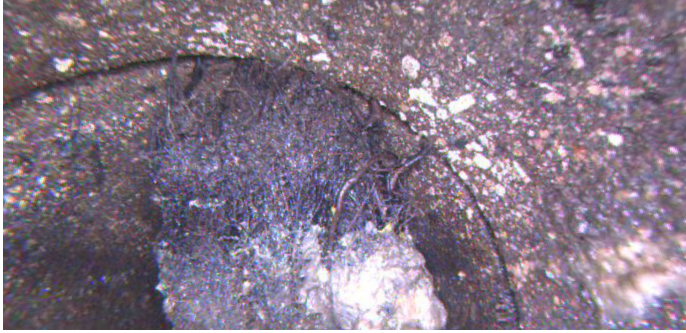

Distance (ft): **.0**
Structural Grade: **0**
O&M Grade: **4**
Clock Start/From: **1**
Clock To: **6**
1st Value:
2nd Value:
Value Percent: **70.000**
Continuous Index:
Within 8" of Joint: **YES**
Remarks:

Code: **MSA**
Description: **Abandoned Survey**

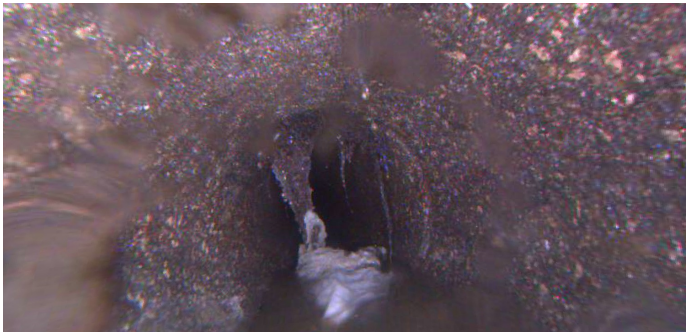

Distance (ft): **3.4**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within 8" of Joint: **NO**
Remarks: **roots**