
| Profile/Ph       | oto Observation I         | Report         |                |        |                            | RedZone       |
|------------------|---------------------------|----------------|----------------|--------|----------------------------|---------------|
| Date:            | 10/12/2018                | Weather:       |                |        | Coding:                    | PACP 6.0      |
| Pipe Length (ft) | : <b>34.0</b>             | Owner:         | NA             |        | Pre Clean:                 | Not Known     |
| P.O.#:           |                           | Surveyor:      | Selasie Honu   | I      | PSR:                       | P-607-068-001 |
| Customer:        |                           | Clean Date:    | 01/01/1900     |        | Shape:                     | с             |
| Street:          | W 14TH ST                 |                | Flow Control:  |        | Not Controlled             |               |
| City:            | Hobart, IN                |                | Year Renewed   | l:     |                            |               |
| Location:        | Light Highway             |                | Tape/Media #   | :      |                            |               |
| Purpose:         | <b>Routine Assessment</b> |                | Dia/Height:    |        | 12"                        |               |
| Use:             | Sanitary                  |                | Material:      |        | VCP                        |               |
| Drain Area:      | NA                        |                | Lining:        |        |                            |               |
| Category:        | NA                        |                |                |        |                            |               |
| Comment:         |                           |                |                |        |                            |               |
| Location Details | s:                        |                | Direction of S | urvey: | Upstream                   |               |
| US MH:           | M-607-001                 | DS MH:         | M-607-068      | T      | otal Length Surveyed (ft): | 31.3          |
| 0&M Index:       | 3.00                      | O&M Quick:     | 3              | 200    | O&M Rating:                | 6.00          |
| tructural Index: | 2.00                      | Structural Qui | ick: 2         | 200    | Structural Rating:         | 4.00          |
| Overall Index:   | 2.50                      | Overall Quick  | : 3            | 222    | Overall Rating:            | 10.00         |






| Code:<br>Description: | AMH<br>Manhole |
|-----------------------|----------------|
| Distance (ft):        | .0             |
| Structural Grade:     | 0              |
| O&M Grade:            | 0              |
| Clock Start/From:     |                |
| Clock To:             |                |
| 1st Value:            |                |
| 2nd Value:            |                |
| Value Percent:        |                |
| Continuous Index:     |                |
| Within 8" of Joint:   | NO             |
| Remarks:              | M-607-068      |

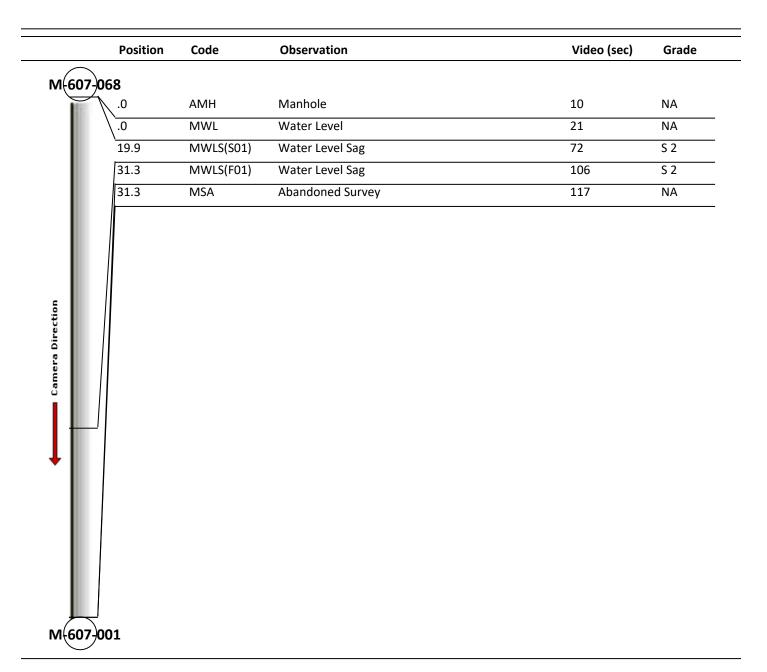

Code: MWL Description: Water Level

| Distance (ft):      | .0    |
|---------------------|-------|
| Structural Grade:   | 0     |
| O&M Grade:          | 0     |
| Clock Start/From:   |       |
| Clock To:           |       |
| 1st Value:          |       |
| 2nd Value:          |       |
| Value Percent:      | 5.000 |
| Continuous Index:   |       |
| Within 8" of Joint: | NO    |
| Remarks:            |       |

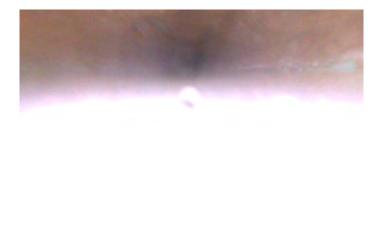

| Code:        | MWLS            |
|--------------|-----------------|
| Description: | Water Level Sag |

| Distance (ft):      | 19.9   |
|---------------------|--------|
| Structural Grade:   | 2      |
| O&M Grade:          | 3      |
| Clock Start/From:   |        |
| Clock To:           |        |
| 1st Value:          |        |
| 2nd Value:          |        |
| Value Percent:      | 20.000 |
| Continuous Index:   | S01    |
| Within 8" of Joint: | NO     |
| Remarks:            |        |



Code:MWLSDescription:Water Level Sag

| Distance (ft):      | 31.3   |
|---------------------|--------|
| Structural Grade:   | 2      |
| O&M Grade:          | 3      |
| Clock Start/From:   |        |
| Clock To:           |        |
| 1st Value:          |        |
| 2nd Value:          |        |
| Value Percent:      | 20.000 |
| Continuous Index:   | F01    |
| Within 8" of Joint: | NO     |
| Remarks:            |        |

Code: Description: MSA Abandoned Survey



| Distance (ft):      | 31.3           |
|---------------------|----------------|
| Structural Grade:   | 0              |
| O&M Grade:          | 0              |
| Clock Start/From:   |                |
| Clock To:           |                |
| 1st Value:          |                |
| 2nd Value:          |                |
| Value Percent:      |                |
| Continuous Index:   |                |
| Within 8" of Joint: | NO             |
| Remarks:            | camera stopped |