Date:	04/19/2018	Weather:		Coding:	PACP 4.2
Pipe Length (ft):	166.5	Owner:	City of Hobart	Pre Clean:	No Pre-Cleaning
P.O.#:	2004	Surveyor:	SAN	PSR:	P-804-035-034
Customer:	Red Zone	Clean Date:		Shape:	С
Street:	232 N Hobart Rd		Flow Control:	Not Controlled	I
City:	Hobart In		Year Renewed:		
Location:	Easement/Right of	Way	Tape/Media #:	Deliverable 1	
Purpose:	Routine Assessmen	t	Dia/Height:	18"	
Use:	Sanitary		Material:	VCP	
Drain Area:	Northeast		Lining:		
Category:	NA				
Comment:	417-1				
Location Details:	Grass between hom	nes	Direction of Surve	ey: Upstream	
US MH:	M-804-035	DS MH:	M-804-034	Total Length Surveyed (ft): 166.5
0&M Index:	1.97	O&M Quick:	2L12	O&M Rating:	134.00
Structural Index:	0.00	 Structural Qu	uick: 0000	Structural Rating:	0.00
Overall Index:	1.97	Overall Quick	. 2L12	Overall Rating:	134.00

M 804-034					
\leq					
	.0	AMH	Manhole	19	NA
())`	.0	MWL	Water Level	39	NA
	2.0	DAE(S01)	Deposits Attached Encrustation	112	M 2
<i>\\`</i>	6.5	TFD	Tap Factory Defective	150	M 2
	9.7	TFD	Tap Factory Defective	233	M 2
	22.2	RFJ	Roots Fine Joint	333	M 1
	22.2	IW(S02)	Infil Weeper	391	M 2
N N	30.8	RFJ	Roots Fine Joint	423	M 1
	57.8	TFD	Tap Factory Defective	606	M 2
	60.8	TFD	Tap Factory Defective	699	M 2
	100.7	TFD	Tap Factory Defective	835	M 2
	104.2	TFD	Tap Factory Defective	892	M 2
	164.2	IW(F02)	Infil Weeper	1072	M 2
	164.2	DAE(F01)	Deposits Attached Encrustation	1086	M 2
	166.5	AMH	Manhole	1134	NA



Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-804-034

M⁽⁸⁰⁴⁾035



Code:	MWL
Description:	Water Level
	_
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	15.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	




Code: Description:	DAE Deposits Attached Encrustation
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index: Within 8" of Joint: Remarks:	2.0 0 2 8 4 10.000 S01 YES



Code: Description:	TFD Tap Factory Defective
Distance (ft):	6.5
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	10
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	infil in tap



Code:	TFD
Description:	Tap Factory Defective
Distance (ft):	9.7
Structural Grade:	0
O&M Grade:	2
Clock Start/From: Clock To: 1st Value:	2 4.000
2nd Value: Value Percent: Continuous Index:	
Within 8" of Joint:	NO
Remarks:	roots and offset in tap

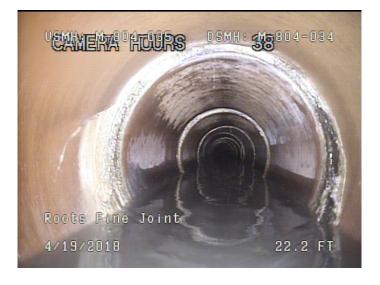

Code: Description:	RFJ Roots Fine Joint
Distance (ft):	22.2
Structural Grade:	0
O&M Grade:	1
Clock Start/From:	10
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code: Description:	IW Infil Weeper
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index:	22.2 0 2 8 4 S02
Within 8" of Joint: Remarks:	YES



Code: Description:	RFJ Roots Fine Joint
Distance (ft):	30.8
Structural Grade:	0
O&M Grade:	1
Clock Start/From:	1
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code: Description:	TFD Tap Factory Defective
Distance (ft):	57.8
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	10
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	infil in tap



Code: Description:	TFD Tap Factory Defective
Distance (ft):	60.8
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	2
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	infil in tap



Code: Description:	TFD Tap Factory Defective
Distance (ft): Structural Grade:	100.7 0
O&M Grade:	2
Clock Start/From:	10
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	infil in tap



Code:	TFD Tap Factory Defective
Description:	Tap Factory Defective
Distance (ft):	104.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	2
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	infil in tap



Code: Description:	IW Infil Weeper
Distance (ft): Structural Grade: O&M Grade: Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: Continuous Index: Within 8" of Joint: Remarks:	164.2 0 2 8 4 F02 YES



Code:DAEDescription:Deposits Attached Encrustation

Distance (ft):	164.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	10.000
Continuous Index:	F01
Within 8" of Joint:	YES
Remarks:	



AMH Manhole
166.5
0
0
NO
M-804-035