
Profile/Ph	oto Observatio	n Report				RedZon
Date:	04/12/2018	Weather:			Coding:	PACP 6.0
Pipe Length (ft): 116.4	Owner:	NA		Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costell	C	PSR:	P-806-056-057
Customer:		Clean Date	: 01/01/190	ט	Shape:	с
Street:	DEER CROSS TRL		Flow Control	:	Not Controlled	
City:	Hobart, IN		Year Renewe	ed:		
Location:	Sidewalk		Tape/Media	#:		
Purpose:	Maintenance Rela	ated	Dia/Height:		8"	
Use:	Sanitary		Material:		PVC	
Drain Area:	NA		Lining:		Cured in Place	
Category:	NA					
Comment:	mh confirmed.					
Location Detail	ls:		Direction of	Survey:	Upstream	
US MH:	M-806-056	DS MH:	M-806-057	To	tal Length Surveyed (ft):	113.3
0&M Index:	2.00	O&M Quick	:	2100	O&M Rating:	2.00
Structural Index:	0.00	Structural C	uick:	0000	Structural Rating:	0.00
Overall Index:	2.00	Overall Qui	ck:	2100	Overall Rating:	2.00





Code:	АМН
Description:	Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-806-057

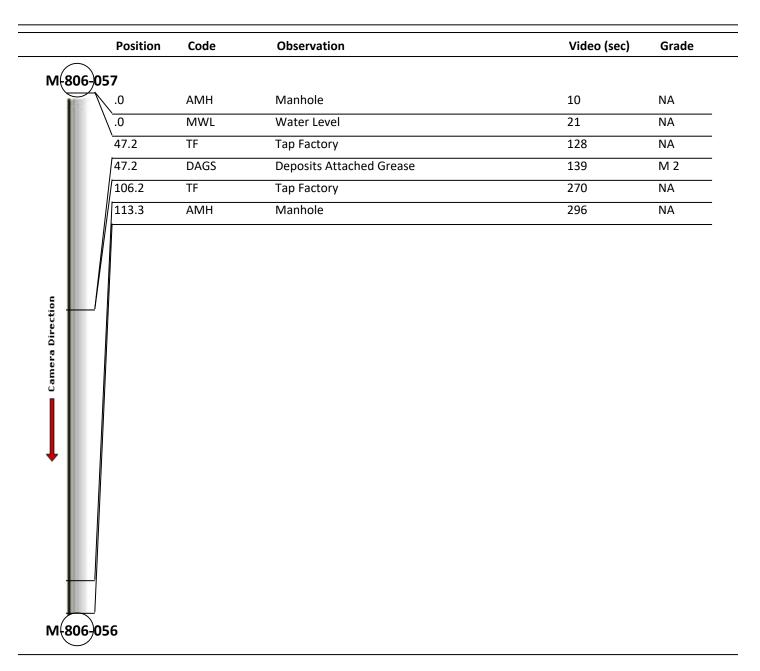


Code: MWL Description: Water Level

Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	




TF Tap Factory
47.2
0
0
2
4.000

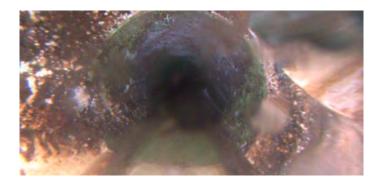

Code:DAGSDescription:Deposits Attached Grease

Distance (ft):	47.2
Structural Grade:	0
O&M Grade:	2
Clock Start/From:	8
Clock To:	4
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	

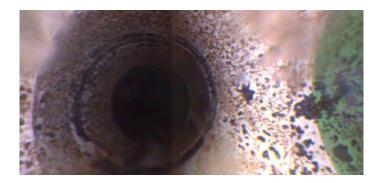

Code: Description:	TF Tap Factory
Distance (ft):	106.2
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	3
Clock To:	
1st Value:	4.000
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	
Remarks:	



Code:	AMH
Description:	Manhole
Distance (ft):	113.3
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	

Clock To: 1st Value: 2nd Value:

Remarks:

Value Percent: Continuous Index: Within 8" of Joint: NO

M-806-056