
Date:	04/02/2018	Weather:		Coding:	PACP 6.0
Pipe Length (ft)	: 173.2	Owner:	NA	Pre Clean:	Not Known
P.O.#:		Surveyor:	Jen Costello	PSR:	P-903-025-028
Customer:		Clean Date:	01/01/1900	Shape:	С
Street:	E RAND ST		Flow Control:	Not Controlled	l
City:	Hobart, IN		Year Renewed:		
Location:	Other		Tape/Media #:		
Purpose:	Not Known		Dia/Height:	12"	
Use:	Sanitary		Material:	VCP	
Drain Area:	NA		Lining:		
Category:	NA				
Comment:					
Location Details:			Direction of Surve	y: Downstream	
US MH:	M-903-025	DS MH:	M-903-028	Total Length Surveyed (ft): 13.1
0&M Index:	3.00	O&M Quick:	3100	O&M Rating:	3.00
Structural Index:	4.00	Structural Qu	iick: 4100	Structural Rating:	4.00
Overall Index:	3.50	Overall Quick		Overall Rating:	7.00





Code: Description:	AMH Manhole
Distance (ft):	.0
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	M-903-025

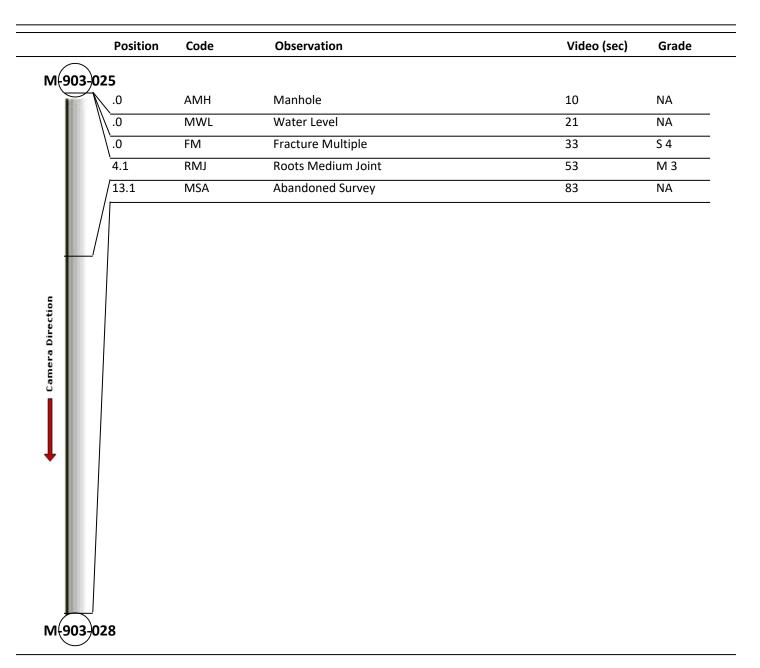

Code: MWL Description: Water Level

Distance (ft): .0 Structural Grade: 0 O&M Grade: 0 Clock Start/From: Clock To: 1st Value: 2nd Value: Value Percent: 30.000 Continuous Index: Within 8" of Joint: NO Remarks:



Code: Description:	FM Fracture Multiple
Distance (ft):	.0
Structural Grade:	4
O&M Grade:	0
Clock Start/From:	11
Clock To:	3
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	



Code:RMJDescription:Roots Medium Joint

Distance (ft):	4.1
Structural Grade:	0
O&M Grade:	3
Clock Start/From:	9
Clock To:	10
1st Value:	
2nd Value:	
Value Percent:	5.000
Continuous Index:	
Within 8" of Joint:	YES
Remarks:	

Code: Description: MSA Abandoned Survey



Distance (ft):	13.1
Structural Grade:	0
O&M Grade:	0
Clock Start/From:	
Clock To:	
1st Value:	
2nd Value:	
Value Percent:	
Continuous Index:	
Within 8" of Joint:	NO
Remarks:	DEBRIS UNDER WATER